ES_LPC122X Errata sheet LPC1224/25/26/27 Rev. 1.2 — 21 March 2012

Errata sheet

Document information

Info	Content
Keywords	LPC1227FBD64, LPC1227FBD48, LPC1226FBD64, LPC1226FBD48, LPC1225FBD64, LPC1225FBD48, LPC1224FBD64, LPC1224FBD48 errata
Abstract	This errata sheet describes both the known functional problems and any deviations from the electrical specifications known at the release date of this document.
	Each deviation is assigned a number and its history is tracked in a table.



ES_LPC122x

Errata sheet LPC1224/25/26/27

Revision history

Rev	Date	Description
1.2	20120321	 Corrected initial device revision from '-' to 'A'.
1.1	20120119	Added ADC.2.
1	20110501	Initial version.

Contact information

For more information, please visit: http://www.nxp.com

For sales office addresses, please send an email to: salesaddresses@nxp.com

1. Product identification

The LPC122x devices typically have the following top-side marking:

LPC122x

/xxx

XXXXXX

xxYYWWxR[x]

The last letter in the last line (field 'R') will identify the device revision. This Errata Sheet covers the following revisions of the LPC122x:

Table 1. Device revision table

Revision identifier (R)	Revision description
'A'	Initial device revision

Field 'YY' states the year the device was manufactured. Field 'WW' states the week the device was manufactured during that year.

2. Errata overview

Table 2. Functional problems table

Functional problems	Short description	Revision identifier	Detailed description
ADC.1	PIO0_2, PIO1_5 trigger sources do not operate properly	'A'	Section 3.1
ADC.2	A/D Global Data register should not be used with burst mode or hardware triggering.	'A'	Section 3.2
RTC.1	Self-timed wakeup from Deep-Sleep requires WDOsc	'A'	Section 3.3

Table 3. AC/DC deviations table

AC/DC deviations	Short description	Product version(s)	Detailed description
n/a	n/a	n/a	n/a

Table 4. Errata notes table

Errata notes	Short description	Revision identifier	Detailed description
n/a	n/a	n/a	n/a

3. Functional problems detail

3.1 ADC.1: PIO0_2, PIO1_5 trigger sources to ADC do not operate properly

Introduction:

There are two asynchronous trigger inputs to the analog to digital converter: PIO0_2 and PIO1_5. There are also four timer driven synchronous trigger sources controlled by timer MAT events.

Problem:

Asynchronous trigger events on PIO0_2 and PIO1_5 can be lost by the analog to digital converter. Synchronous sources are unaffected and can be used without issue.

Work-around:

None.

3.2 ADC.2: A/D Global Data register should not be used with burst mode or hardware triggering

Introduction:

On the LPC122x, the START field and the BURST bit in the A/D control register specify whether A/D conversions are initiated via software command, in response to some hardware trigger, or continuously in burst ("hardware-scan") mode. Results of the ADC conversions can be read in one of two ways. One is to use the A/D Global Data Register to read all data from the ADC. Another is to use the individual A/D Channel Data Registers.

Problem:

If the burst mode is enabled (BURST bit set to '1') or if hardware triggering is specified, the A/D conversion results read from the A/D Global Data register could be incorrect. If conversions are only launched directly by software command (BURST bit = '0' and START = '001'), the results read from the A/D Global Data register will be correct provided the previous result is read prior to launching a new conversion.

Work-around:

When using either burst mode or hardware triggering, the individual A/D Channel Data registers should be used instead of the A/D Global Data register to read the A/D conversion results.

3.3 RTC.1: RTC Wake up from Deep-sleep requires use of WDOsc

Introduction:

The LPC122x features the ability to wake up from Deep-sleep mode in a self timed manner using the lower power Real Time Clock (RTC). Once RTC is powered and the clock source is configured, a match event will generate an interrupt and wake the LPC122x.

Problem:

In order to wake from Deep-sleep via RTC, the system must be clocked by the WDOsc while in Deep-Sleep.

Work-around:

Prior to entering Deep-sleep the WDOsc must be powered, and the main clock source selection register must source the main clock with the WDOsc. The WDOsc must be configured to use the lowest operating frequency by selecting the 0.5 MHz input (FREQSEL) and post divide value of 64 (DIVSEL). The Deep-sleep mode configuration register must be written with values corresponding to the "WD oscillator on" column in Table 44 of the User Manual. Refer to the section "Deep-sleep mode" in the Power Management section of the System Control chapter of the User Manual for additional details and restrictions on Deep-sleep.

4. AC/DC deviations detail

4.1 n/a

5. Errata notes detail

5.1 n/a

6. Legal information

6.1 Definitions

Draft — The document is a draft version only. The content is still under internal review and subject to formal approval, which may result in modifications or additions. NXP Semiconductors does not give any representations or warranties as to the accuracy or completeness of information included herein and shall have no liability for the consequences of use of such information.

6.2 Disclaimers

Limited warranty and liability — Information in this document is believed to be accurate and reliable. However, NXP Semiconductors does not give any representations or warranties, expressed or implied, as to the accuracy or completeness of such information and shall have no liability for the consequences of use of such information. NXP Semiconductors takes no responsibility for the content in this document if provided by an information source outside of NXP Semiconductors.

In no event shall NXP Semiconductors be liable for any indirect, incidental, punitive, special or consequential damages (including - without limitation - lost profits, lost savings, business interruption, costs related to the removal or replacement of any products or rework charges) whether or not such damages are based on tort (including negligence), warranty, breach of contract or any other legal theory.

Notwithstanding any damages that customer might incur for any reason whatsoever, NXP Semiconductors' aggregate and cumulative liability towards customer for the products described herein shall be limited in accordance with the *Terms and conditions of commercial sale* of NXP Semiconductors.

Right to make changes — NXP Semiconductors reserves the right to make changes to information published in this document, including without limitation specifications and product descriptions, at any time and without notice. This document supersedes and replaces all information supplied prior to the publication hereof.

Suitability for use — NXP Semiconductors products are not designed, authorized or warranted to be suitable for use in life support, life-critical or safety-critical systems or equipment, nor in applications where failure or

malfunction of an NXP Semiconductors product can reasonably be expected to result in personal injury, death or severe property or environmental damage. NXP Semiconductors and its suppliers accept no liability for inclusion and/or use of NXP Semiconductors products in such equipment or applications and therefore such inclusion and/or use is at the customer's own risk

Applications — Applications that are described herein for any of these products are for illustrative purposes only. NXP Semiconductors makes no representation or warranty that such applications will be suitable for the specified use without further testing or modification.

Customers are responsible for the design and operation of their applications and products using NXP Semiconductors products, and NXP Semiconductors accepts no liability for any assistance with applications or customer product design. It is customer's sole responsibility to determine whether the NXP Semiconductors product is suitable and fit for the customer's applications and products planned, as well as for the planned application and use of customer's third party customer(s). Customers should provide appropriate design and operating safeguards to minimize the risks associated with their applications and products.

NXP Semiconductors does not accept any liability related to any default, damage, costs or problem which is based on any weakness or default in the customer's applications or products, or the application or use by customer's third party customer(s). Customer is responsible for doing all necessary testing for the customer's applications and products using NXP Semiconductors products in order to avoid a default of the applications and the products or of the application or use by customer's third party customer(s). NXP does not accept any liability in this respect.

Export control — This document as well as the item(s) described herein may be subject to export control regulations. Export might require a prior authorization from competent authorities.

6.3 Trademarks

Notice: All referenced brands, product names, service names and trademarks are the property of their respective owners.



Errata sheet LPC1224/25/26/27

7. Contents

1	Product identification 3
2	Errata overview 3
3	Functional problems detail 4
3.1	ADC.1: PIO0_2, PIO1_5 trigger sources to ADC
	do not operate properly 4
	Introduction:
	Problem:
	Work-around:
3.2	ADC.2: A/D Global Data register should not be
	used with burst mode or hardware triggering 4
	Introduction:
	Problem:
3.3	RTC.1: RTC Wake up from Deep-sleep requires
0.0	use of WDOsc 5
	Introduction:
	Problem:
	Work-around:
4	AC/DC deviations detail 5
4.1	n/a 5
5	Errata notes detail 5
5.1	n/a 5
6	Legal information 6
6.1	Definitions
6.2	Disclaimers 6
6.3	Trademarks6
7	Contents

Please be aware that important notices concerning this document and the product(s) described herein, have been included in section 'Legal information'.